



Release Notes :
Aastra IntelliGate® 20x5 / 150 / 300
Neris 2IP/bàsica, Neris 8/64 (Spain)



SW Version Name:	Aastra IntelliGate I7.9 SP6 - HOTFIX7 (f938/pbx7938f1)
Further software enclosed in this Package	AIP 6500: 7.9.6
	Office 35IP: 1.6.2
	Aastra 5360ip/5370ip/5380ip: 2.60.11
	Aastra 5360/5370/5380 AD2: 2.60.3.7
	Aastra M530 / M535: 0.8.7.0
	Office 160: 41.4500
	Office 135: 61.3900
	Aastra 610d/620d/630d: 129.2.34 (with SD-card support)
	Aastra 612d/622d/632d/650c: 129.4.3 (needs AIMS 7.95.03)
	SB4+ / SB8 / SB8ANT (HW-1): 1.21.00
	SB4 00.84.6E
	SIP-DECT OMM: 2.1 // Aastra 600d SW: 3.03
	Aastra 675xi/673xi: 3.2.2.56 (GA 28.june 2011, br48230)
	Aastra 6739i: 3.2.2.56 (GA 28.June.2011, br48230)
	Aastra 312w: 1.0.10
Aastra WebAdmin: 2.31	
Release date:	Dec 15th 2015

Date : 15. Dec 2015
 Doc.no.: depl-2237
 Version: 0.3

1. Compatibility

SW	Version	Additional Information
PBX boot software	A150/A300-1: 7.00/pbx7037a0 A150/A300-2: b933/pbx7933b0 20x5: 7.50/pbx7528c0	
AIMS	7.95.03 or higher <u>mandatory</u> for compatibility	AIMS 7.95.04 is available (solves a problem on Win 8.1)
PM	7.9.3.1	
Aastra 2380ip	2.x.0.0 - 2.21.0.0 / 2.50.0.0	see Footnote 2)
OIP 7.9 / 8.2	7.9.3.0 / 8.2.0.12	OIP 8.2.0.12 (March 2014) supports new Java versions.
OIP 8.5.x.x	8.5.2.8 / 8.5.2.10	see Footnote 1)
Office 1560/1560IP (in OIP)	2.5.5.0 in OIP 7.9 2.9.7.0 in OIP 8.2	1560IP 2.5.5.0 not comp. Win 7 1560IP 2.9.7.0 not comp. to I7.9
Office 1560IP (load separately)	2.6.5.0	compatible to Win 7 and to I7.9
Office eDial	2.0.6.0 / 2.0.8.0	compatible to 7.70 and higher
AIF TSP	1.3.1.0 / 1.4.0.0	compatible to 7.70 and higher
AIP 6400	5.52	Unchanged since I6.5
AVS	6.69 / 6.70	Unchanged since I6.6
SB4+ / SB8 (HW-2)	2.0.9	from fabrication

Further details, see compatibility list CL-669 in Aastra Knowledge Base

- 1) OIP 8.5.2.8 / 8.5.2.10 is compatible with IntelliGate I7.9 (for mixed env. with Aastra 400): but:
 - Office 1560 and 1560ip are not available and Aastra 1560ip is not supported.
 - Only Aastra 1560 can be used.
 - Key config must be done on the terminal. It is not available in OIP 8.5, OfficeSuite, or SSP.
- 2) 2380ip 2.50.0.0 (for IntelliGate) is compatible with Windows 8/8.1
 - It contains all fixes and components of 2380ip 3.7.2.0 (for Aastra 400 R2.x)
- 3) AIMS 7.95.03 is mandatory for I7.9 SP6 and higher. AIMS 7.95.03 is compatible to Win 8/8.1
 - Don't use AIMS 7.95.02 (it will create an obsolete folder in the PBX-filesystem)
- 4) The new AD2 terminal interfaces require Release I7.9 SP4 (7.96) or higher
 - Aastra IntelliGate 150/300 (HW-2) & EADP4 (HW-3).
 - The Pocket Adapter is not supported on the new AD2 interfaces anymore.

2. Purpose

This is a Aastra IntelliGate I7.9 SP6 - HOTFIX7 (f938/pbx7938f1). It contains several Customer fixes.

- Deltas listed since Aastra IntelliGate I7.9 SP6 (7.98/pbx7937g1, 129.2.20, 129.3.22).

3. Solved issues

3.1 Solved Issues in Aastra IntelliGate® I7.9 SP6 HF7

TT#	CSU	ADBT	Title
189802 189992	Nordic	56859	SIP-T: calls disconnected when using DNS_SRV of sip.telavox.se
191738	Germany	57294	New satellite does not go online (cyclic reboot)
199400	Germany	58245	AIN Master 2065 reboots in relation with PSTN overflow call with voicemail involved
201440	Denmark	58515	Call does not jump to next available user on cyclic UG with external diversion

3.2 Solved Issues in Aastra IntelliGate® I7.9 SP6 HF6

TT#	CSU	ADBT	Title
190173	Switzerland	56939	Daily PBX reboot ... time lock when incoming call is routed twice to the same GSM (once directly, once via CFNR from another phone in the same "one number")
-	Switzerland	56910	SIP provider "Swisscom Business Connect" suddenly not registered. (improvement, tracing)
184300	Nordic	56423	GSM Integration ignoring DTMF
187429	Denmark	56384	calls not presented correct after transfer from Auto attendant
179698 186549	Australia Austria	54728	Not possible to block "sending text messages" on 600d
183696	Norway	55596	Problem with DTMF signaling on internal calls from phones type ASCOM d81 (9d24)
184556	Switzerland	55829	External call state does not change to hold, call handling failed.
-	Switzerland	56205	SIP-T: Call rejected if auto attendant route to external
179189	Denmark	54721	Not possible to transfer call answered in 1560 ACD to another 1560 ACD

3.3 Solved Issues in Aastra IntelliGate® I7.9 SP6 HF5

TT#	CSU	ADBT	Title
179556	Switzerland	54738	AIN: Intrusion not possible from IP-Phone to IP-Phone

3.4 Solved Issues in Aastra IntelliGate® I7.9 SP6 HF4

TT#	CSU	ADBT	Title
175472	UK	54270	Intelligate AIN: voicemail fails on internal calls across nodes
174402	Switzerland	54307	Wakeup call and callback
177838	Switzerland	54479	DECT not ringing using DECT follow me
134992	Switzerland / Lichtenstein	50253	PBX-reboots 3 times a day. (filemanager reaches a limit that blocks a process, then the PBX reboots to recover).

3.5 Solved Issues in Aastra IntelliGate® I7.9 SP6 HF3

TT#	CSU	ADBT	Title
137835	Belgium	53766	Alarm does not show when arriving during Dect groupcall
175609	UK	54088	System reset after ending call with intrusion

3.6 Solved Issues in Aastra IntelliGate® since I7.9 SP6 HF2

TT#	CSU	ADBT	Title
136046	Netherlands	53310	Ascom Dect GAP handsets 9d24, ringing spontaneous (occured since upgrade to I7.9 SP6)
135281	UK	53067 (48092)	IntelliGate 2065 restart (out of memory, sometimes caused by new Jabra headsets)
168573	Austria	53773	SIP to SIP trunk transfer - session refresh from provider not accepted

3.7 Solved Issues in Aastra IntelliGate® since I7.9 SP6 HF1

TT#	CSU	ADBT	Title
136046	Netherlands	53310	Ascom Dect GAP handsets 9d24, ringing spontaneous (occured since upgrade to I7.9 SP6)
135281	UK	53067 (48092)	IntelliGate 2065 restart (out of memory, sometimes caused by new Jabra headsets)

3.8 Solved Issues in Aastra 600d 129.2.34, Aastra 602d/650c 129.4.3 since I7.9 SP6 HF5

TT#	CSU	ADBT	Title
184087	Switzerland	55850	DECT: Re-Register with Aastra600d sometime not working
183523	Netherlands (Aastra 400)	55561	AMS / Webadmin: configured ACD log in/out key doesn't work
	-	55331	Presence Menu configured on Fox key not ok
	-	54942	Call list: popup "empty list" and automatic return not ok since 129.2.27 and 129.3.31

TT#	CSU	ADBT	Title
	Switzerland	55197	Improve survey mode for Special SW z937, all SB in 1 area (depl-2081)

3.9 Solved Issues in Aastra 600d 129.2.27, Aastra 602d/650c 129.3.31 since I7.9 SP6 HF4

TT#	CSU	ADBT	Title
127445	Switzerland	52213	Fading till One-Way-Audio with Aastra 600d (Happened only with the the old product Aastra 610d/620d/630d. Observed since mid of 2013. SW-solution found in firmware and tested.)
127446	Switzerland		
128807	Switzerland		
130517	Switzerland		
130990	Switzerland		
130999	Switzerland		
135034	Switzerland		
135091	Switzerland		
135255	Switzerland		
135930	Switzerland		
137174	Switzerland		
175125	Switzerland		
175217	Switzerland		
175218	Switzerland		
175434	Switzerland		
135034	Switzerland	54042	Macx getCallState shall not allocate B channel (fix of br51777 shall not use B-channels on SB)
135518	Netherland	53110	No wrapup time displayed on MacX devices
176826	Germany	54302	DECT 6x0d: supressed ringtone on server alarm do not work properly

3.10 Solved Issues in Aastra 600d 129.2.26, Aastra 602d/650c 129.3.30 since I7.9 SP6 HF2

TT#	CSU	ADBT	Title
128884	Switzerland	53140	UserGroup: Sometimes no entry in the missed calls list
128357	Switzerland	51973	Sporadic link lost: LED blinks red and 'no System' on display
129405	Switzerland		
130004	Switzerland		
130931	Switzerland		
131147	Switzerland		
136584	Germany		

TT#	CSU	ADBT	Title
128565	Switzerland	51577	UserGroup: Handset continues ringing
129431	Switzerland		
130004	Switzerland		
130489	Switzerland		
131342	Switzerland		
131546	Switzerland		
131559	Switzerland		
132842	Switzerland		
135034	Switzerland		
135939	Switzerland		
136930	Switzerland		
137019	Switzerland		

4. Important Hints

4.1 AMCC on I7.9 IntelliGate

AMCC on Aastra IntelliGate is supported since I7.9 SP2 7.93.

4.2 Support of Hotel Interface

4.2.1 FM 1.2 TAB "Local event message destinations" in AIMS

The output format (Plain and PC) of "PBX system alarms" can now also be plaintext for all local IP alarm destinations (PPP via ISDN internal, PPP via analogue internal and Ethernet).

The output format for a local IP alarm destination can be changed when:

1. Enable the alarm printer (V24/PA)
2. Set the output format
3. May chose the output language
4. Enable the IP destination
5. Reconfigure the IP destination

4.3 AIMS UM delay with IntelliGate 20x5 after SW upload via ISDN

4.3.1 IntelliGate 20x5 reboots only 42 minutes after SW upload

After a SW upload from I7.9 SP4 (7.96) to I7.9 SP5 (and higher) via ISDN: the IntelliGate 20x5 starts reboot only after 42 minutes. This delay occurs, if the origin SW is I7.9 SP4 (7.96).

4.4 Known open issue with Aastra 602d/650c

- br53879 / GS-174282 / GS 174301 / GS 174580 Ringing on 632d not as loud as 630d. This is a property of a different HW component. => Workaround: select a melody that is easy to hear and use the vibra. (Alarming melodies appear still loud because the melodies contain subjectively louder frequencies.)

4.5 Solved issue with Aastra 602d/650c since 2Q 2014, newer HS-SW in fabrication

- br53360 / br54091 / GS-175640: New type of Micro SD card does not work automatically to move user config to a fabric new 612d/622d/632d/650c.